

# Ultrasonic Diffuse, Digital Output Types UA18CAD.....TI

CARLO GAVAZZI



- Cylindrical M18 PBT housing
- Sensing distance: 50-2200 mm
- Power supply: 15 to 30 VDC
- Outputs: Two multi function switching outputs. PNP or NPN
- Setup: Normal switching or adjustable hysteresis
- Repeatability 0.5%
- Beam angle.  $\pm 7^\circ$  or  $\pm 8^\circ$
- Protection: Short-circuit, reverse polarity and overvoltage
- Protection degree IP 67
- 2 m cable or M12 plug

## Product Description

A self-contained multi function diffuse ultrasonic sensor with a sensing range of 50 to 2200 mm in three ranges. 2 switching outputs - easily set up for two different output modes and adjusted by teach-in - makes it ideal for level control tasks in a wide variety of vessels. A sturdy

one-piece polyester housing provides the perfect packaging for the sophisticated microprocessor controlled and digitally filtered sensor electronics. Excellent EMC performance and precision are typical features of this sensor on true distance measurement.

## Ordering Key

UA18CAD04NPM1TI

Ultrasonic sensor	_____
Housing style	_____
Housing size	_____
Housing material	_____
Housing length	_____
Detection principle	_____
Sensing distance	_____
Output type	_____
Output configuration	_____
Connection	_____
Teach-in	_____

## Type Selection

Housing diameter	Connection	Rated operating dist. (S <sub>n</sub> )	Digital output NPN/PNP	Ordering no.
M18	Plug M12	50-400 mm	2 x NPN	UA 18 CAD 04 NP M1 TI
M18	Cable	50-400 mm	2 x NPN	UA 18 CAD 04 NP TI
M18	Plug M12	50-400 mm	2 x PNP	UA 18 CAD 04 PP M1 TI
M18	Cable	50-400 mm	2 x PNP	UA 18 CAD 04 PP TI
M18	Plug M12	100-900 mm	2 x NPN	UA 18 CAD 09 NP M1 TI
M18	Cable	100-900 mm	2 x NPN	UA 18 CAD 09 NP TI
M18	Plug M12	100-900 mm	2 x PNP	UA 18 CAD 09 PP M1 TI
M18	Cable	100-900 mm	2 x PNP	UA 18 CAD 09 PP TI
M18	Plug M12	200-2200 mm	2 x NPN	UA 18 CAD 22 NP M1 TI
M18	Cable	200-2200 mm	2 x NPN	UA 18 CAD 22 NP TI
M18	Plug M12	200-2200 mm	2 x PNP	UA 18 CAD 22 PP M1 TI
M18	Cable	200-2200 mm	2 x PNP	UA 18 CAD 22 PP TI


## Specifications

Rated operating distance (S <sub>n</sub> )	Reference target: 1 mm metal rolled finish.	Repeatability	0.5%	
	CAD04: 100 x 100 mm		Beam angle	
	CAD09 and CAD22: 200 x 200 mm		UA18CAD04...	$\pm 8^\circ$
UA18CAD04	50 - 400 mm	UA18CAD09...	$\pm 7^\circ$	
UA18CAD09	100 - 900 mm	UA18CAD22...	$\pm 7^\circ$	
UA18CAD22	200 - 2200 mm	Adjustment	P1 (farthest setpoint) P2 (nearest setpoint)	
Blind zone		Push-button		
UA18CAD04...	$\leq 50$ mm	Temperature drift	$\leq 0.1\%/^\circ\text{C}$ @ $-20^\circ$ to $+60^\circ\text{C}$	
UA18CAD09...	$\leq 100$ mm	Temperature compensation	Yes	
UA18CAD22...	$\leq 200$ mm			


## Specifications (cont.)

<b>Hysteresis (H)</b>	Min. 1%	Normal Switching function with N.O. output. Adjustable hysteresis Filling or emptying control
<b>Rated operational voltage (<math>U_B</math>)</b>	15 to 30 VDC (ripple included)	
<b>Ripple (<math>U_{rip}</math>)</b>	≤ 5%	
<b>No-load supply current (<math>I_o</math>)</b>		<b>Indication Output ON</b>
UA18CAD04...	≤ 45 mA @ $U_B$ max	Yellow LED
UA18CAD09...	≤ 45 mA @ $U_B$ max	<b>Environment</b>
UA18CAD22...	≤ 50 mA @ $U_B$ max	Installation category
<b>Output current continuous (<math>I_o</math>)</b>		Pollution degree
Max. load capacity 100 nF	≤ 500 mA	Degree of protection
UL508 specification	≤ 100 mA	<b>Ambient temperature</b>
<b>Output current short-time (I)</b>		Operating
Max. load capacity 100 nF	≤ 500 mA	Storage
UL508 specification	≤ 100 mA	<b>Vibration</b>
<b>Minimum operational current (<math>I_m</math>)</b>	≤ 0.5 mA	10 to 55 Hz, 1.0 mm/6g (IEC/EN 60068-2-6)
<b>OFF-state current (<math>I_r</math>)</b>	≤ 10 $\mu$ A	<b>Shock</b>
<b>Voltage drop (<math>U_d</math>)</b>	≤ 2.2 VDC @ $I_o$ max.	30 g / 11 mS, 3 directions (IEC/EN 60068-2-27)
<b>Protection</b>	Short-circuit, overvoltage and reverse polarity	<b>Rated insulation voltage</b>
<b>Carrier frequency</b>		< 500 VAC (rms)
UA18CAD04...	400 kHz	<b>Housing</b>
UA18CAD09...	300 kHz	Material body
UA18CAD22...	200 kHz	Material front
<b>Operating frequency (f)</b>		Material back, plug
UA18CAD04...	≤ 10 Hz	Material back, cable
UA18CAD09...	≤ 4 Hz	Material push-button
UA18CAD22...	≤ 1 Hz	Sealing around push-button
<b>Response time OFF-ON (<math>t_{ON}</math>)</b>		Material sealing front
UA18CAD04...	≤ 50 mS	UA18CAD04...
UA18CAD09...	≤ 125 mS	UA18CAD09...
UA18CAD22...	≤ 500 mS	UA18CAD22...
<b>Response time ON-OFF (<math>t_{OFF}</math>)</b>		<b>Connection</b>
UA18CAD04...	≤ 50 mS	Cable
UA18CAD09...	≤ 125 mS	PVC, grey, 2 m, 4 x 0.32 mm <sup>2</sup> , $\varnothing = 4.7$
UA18CAD22...	≤ 500 mS	mm
<b>Power ON delay</b>	≤ 900 mS	Plug
<b>Output function, open collector</b>		M12, 4-pin (CON. 14-series)
By sensor type	NPN or PNP	<b>Tightening torque</b>
<b>Output switching function</b>	Two open collector transistor outputs to be configured as:	≤ 1 Nm
		<b>Weight</b>
		Cable version
		Plug version
		<b>CE-marking</b>
		Yes
		<b>Approvals</b>
		cULus (UL508)





## Wiring Diagram

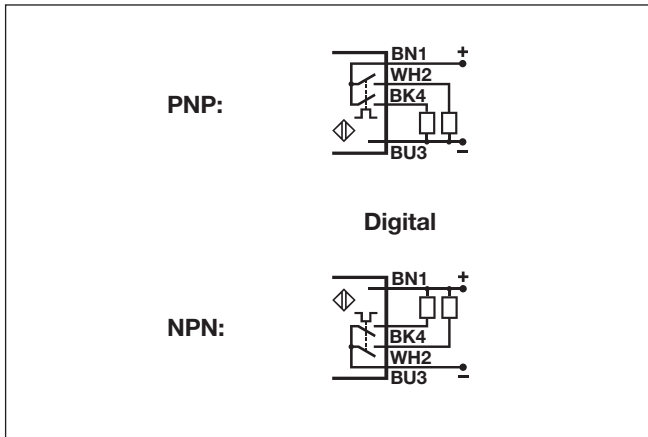

## Detection Range

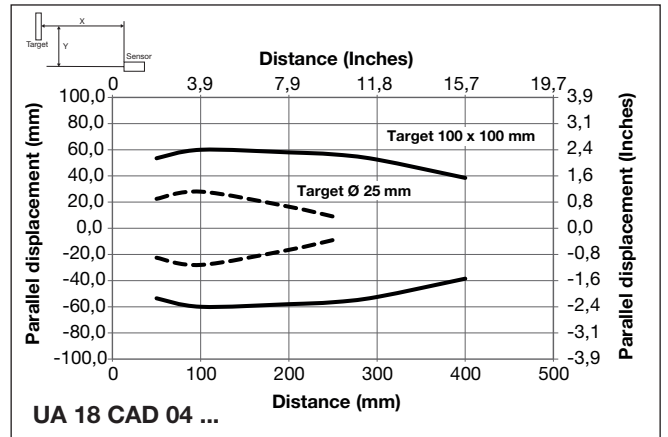

## Dimensions

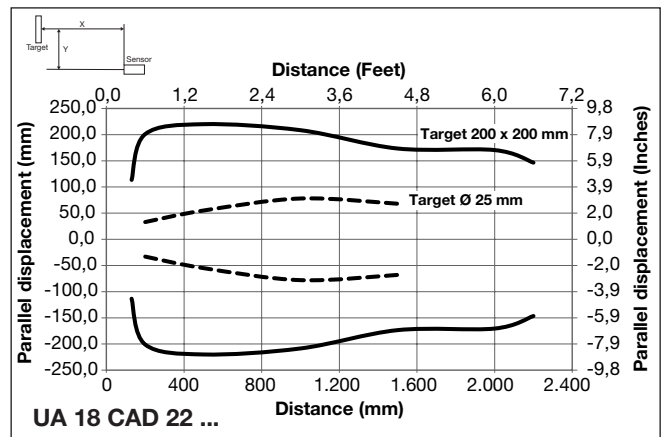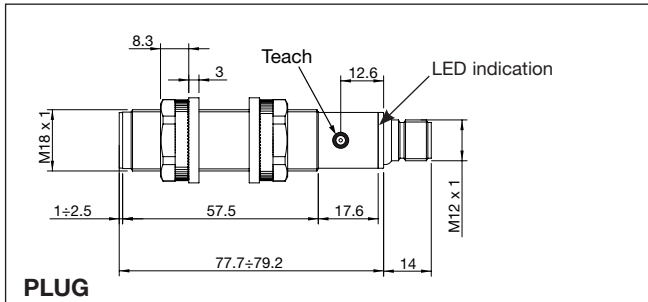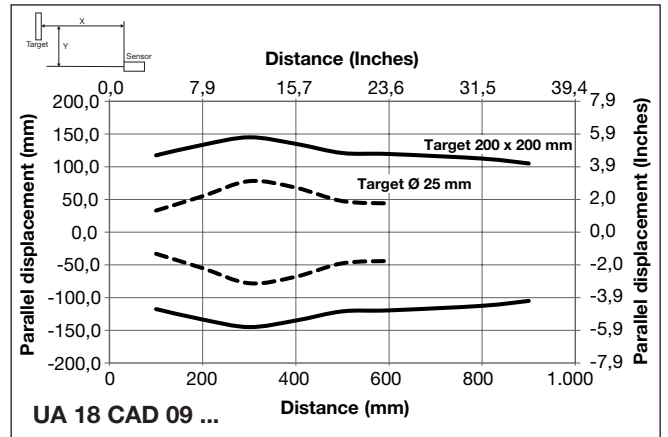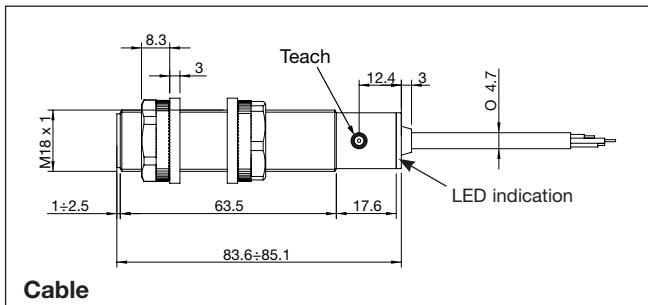

## Programming setup

**General set up of sensing point P1 (longest distance) and P2 (shortest distance) independently of the sensor type or function.**


- 1) Mount the sensor in the selected application.
- 2) Place a target in front of the sensor at the maximum required distance (P1), then press shortly on the teach-button. The yellow LED switches Off and then On again after a maximum of 2 seconds. Now, the distance (P1) is saved in the sensor, and the target can be moved. I)
- 3) Place the target at the minimum distance requested (P2), then press shortly on the teach-button. The yellow LED turns Off and then flashes 5 times. Now, the distance (P2) is saved in the sensor and the target can be moved. II)

I) P1 can be set to maximum exceeding the family specification for the sensor by removing the target in front of the sensor. Push and hold the teach-button for more than one second and the sensing distance is set at a unique distance for this sensor only.


II) The second switch point can be set to minimum by setting the target within the blind zone close to the sensor head or by covering the sensor head with your hand while teaching P2.

**Sensors with 2 digital outputs: UA..CAD..PP/NP types, Normal sensing function or Adjustable Hysteresis**

- 1) The factory settings are normal sensing function.







- 2) Push and hold the teach-button for 8 seconds (12 for UC18CAD22..) until the yellow LED flashes fast, then release the teach-button and the LED will flash 5 times to acknowledge the change in function. Now, the sensor is in adjustable hysteresis mode.

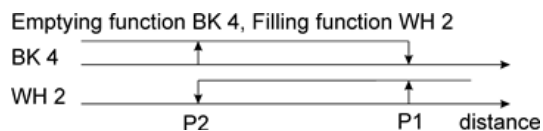

- 3) To switch back to normal function, repeat step 2.

## Installation Hints
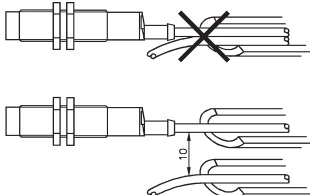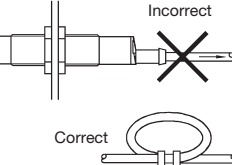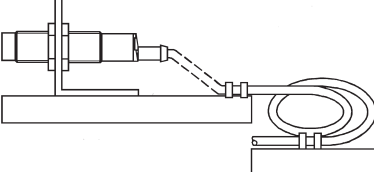
<p>To avoid interference from inductive voltage/current peaks, separate the prox. switch power cables from any other power cables, e.g. motor, contactor or solenoid cables</p> 	<p>Relief of cable strain</p>  <p>The cable should not be pulled</p>	<p>Protection of the sensing face</p>  <p>A proximity switch should not serve as mechanical stop</p>	<p>Switch mounted on mobile carrier</p>  <p>Any repetitive flexing of the cable should be avoided</p>
---	---	---	--

## Delivery Contents

- Ultrasonic sensor: UA18CAD....
- Installation instruction
- Mounting:
  - 2 x M18 Nuts
  - 2 x rubber washers
- **Packaging:** Carton box 35 x 107 x 173 mm